



RECREATIONAL AVIATION AUSTRALIA INC

23 August 2006

ULTRALIGHT AIRCRAFT AIRWORTHINESS NOTICE

AIRWORTHINESS NOTICE IDENTIFICATION NUMBER : 230806-1

Tecnam P92J, P92JS and Sierra

To: All owners and operators of Tecnam P92J, P92JS and Sierra aircraft.

Reason: The absence of the forward stops of the seat rails was ascertained on one aircraft of the applicable types. This condition, if uncorrected, could cause the seat to come out of the rails with subsequent possibility for the occupant to be injured and difficulty in controlling the aircraft.

Compliance: The following measure is rendered mandatory from the effective date of this AN. Within the next 50 hours time-in-service after the effective date of this AN, unless accomplished previously, verify the installation of the forward plugs and stops of the seat rails as described in the Tecnam SB 001-CS or later approved revisions. If some plugs or stops are not installed, immediately contact Tecnam for the supply of the plugs and stops and for the relevant installation instructions.

Further Action: Checks and compliance of AN230806-1 are to be recorded in the aircraft log book.

Note: This AN has been issued in line with EASA AD 2006-0234

Technical Manager

Defect Reporting is one of the primary ways we have in ensuring continued safety in our operations.